




NYC DEPARTMENT OF

Asbestos Control Program

59-17 Junction Boulevard, 8th Floor, Flushing, NY 11373

ASBESTOS ASSESSMENT REPORT

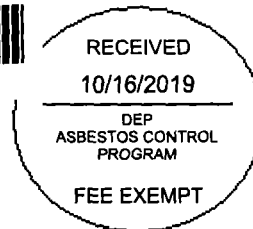

1. NYC DOB Job # (if applicable) _____ **Control Number: 1637697**

2. Premise No. 1230 Street Name fifth ave Borough Manhattan Zip 10029

3. AKA _____ Type of Facility School BIN 1051499 Block 01610 Lot 0001

4. Building Owner NYC Dept of Citywide Administrative Services (DCAS) Address 1 Center street, suite 17

5. City New York State NY Zip 10007 Contact Person Joseph Wagner

6. Tel. # (212) 639-9675 Fax # _____ Email jwagner@dcasnyc.com

7. Work Type PL Plumbing, General Construction

Description of the Entire Scope of Work

Alt II demolition of existing bathroom on the 3rd floor. construction & demo to interior walls. no change in use, egress or occupancy. Plumbing work to be filed under separate app.

8. I, LINDA ULTEE, have conducted an asbestos investigation on
Name of Certified Asbestos Investigator
10/11/2019 10:00AM-11:00AM in accordance
Date(s)
with Sections 1-16 and 1-28 of the NYC DEP Asbestos Control Program Rules and declare that at said facility address, the
- ☐ a. the premises or the portion(s) of the premises, included in the scope of renovations was/were determined that there was no asbestos-containing materials (ACM) present
- ☒ b. premise (or portions thereof) affected by the work contains 10 square feet or less or 25 linear feet or less of ACM.
Specify locations in section 9: Note: This material must be abated as a minor project in accordance with relevant provisions of the DEP Asbestos Rules.
- ☐ c. asbestos is present and will not be disturbed during construction activity. Specify the quantity and area where asbestos is present. Specify amount: _____ sq. ft _____ linear ft.
- ☐ d. entire building is free of asbestos containing material (ACM).

9. RESULTS OF ASBESTOS BUILDING SURVEY:

Floor	Section of Floor(s) Surveyed	Material Assumed to Contain ACM and/or Sampled	Number of Samples Analyzed	Asbestos Present	Assumed ACM	Square Feet	Linear Feet	Abated	Scope of Work Applied
Building Floors-3 to 3	bathrooms, & storage room	plaster	8	No	No				


I have advised the Owner / owner's representative / client that the minor project amounts of the confirmed or presumed ACMs shall need to be abated by a NYS DOL Licensed Asbestos Abatement Contractor, and disposed of as asbestos-containing wastes, prior to conducting this renovation project.

I hereby declare the information provided herein is true and complete

LINDA ULTEE 10/16/2019 117704 4/29/2020
DEP Certified Asbestos Investigator's Signature Date Certificate Number Expiration Date

Tel. # (917) 376-4192 Fax # _____

Email lultee@yahoo.com

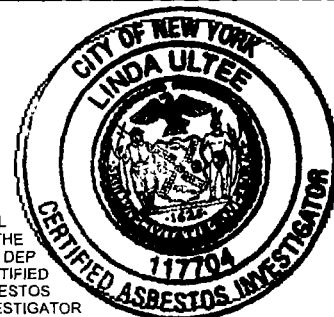

The investigator shall assume that some or all of the areas investigated contain ACM, and for each area that is not assumed to contain ACM, collect and submit for analysis bulk samples in accordance with §§ 1-36, 1-37, and 1-44 of the DEP Asbestos Rules and EPA publications 560/5-85-024 and 560/5-85-030a and 40 CFR 763.86

Is it a Build-It-Back project? ☐ Yes, App ID # _____ ☒ No





NYC DEPARTMENT OF ENVIRONMENTAL PROTECTION
Asbestos Control Program
59-17 Junction Boulevard, 8th Floor, Flushing, NY 11373
ASBESTOS ASSESSMENT REPORT



Building Floors-3 to 3	bathrooms, & storage room	grout	2	No	No				
Building Floors-3 to 3	bathrooms, & storage room	tile set	2	No	No				
Building Floors-3 to 3	bathrooms, & storage room	12x12 floor tile storage	2	No	No				
Building Floors-3 to 3	bathrooms, & storage room	blue tile under 12x12	2	No	No				
Building Floors-3 to 3	bathrooms, & storage room	12x12 HC bathroom	2	No	No				
Building Floors-3 to 3	bathrooms, & storage room	cove base	2	No	No				
Building Floors-3 to 3	bathrooms, & storage room	pipe fittings	2	Yes	No		8	No	b

10. ANALYTICAL LABORATORY:

NAME	ELAP # (NYS DOH CERTIFICATION)	DATE(S) SAMPLES ANALYZED
atlas Environmental Lab	11999	10/14/2019

11. NYS DOL Asbestos Handling license # 87850 Company Name DBC Environmental

12. Comment

2 fittings accessed and sampled in ladies room sink shaft. have to assume a few more on risers in shaft between mens and ladies. shafts will be remaining. plumber will need to field determine what if any abatement he will need to be done.


I have advised the Owner / owner's representative / client that the minor project amounts of the confirmed or presumed ACMs shall need to be abated by a NYS DOL Licensed Asbestos Abatement Contractor, and disposed of as asbestos-containing wastes, prior to conducting this renovation project.

I hereby declare the information provided herein is true and complete

LINDA ULTEE 10/16/2019 117704 4/29/2020
DEP Certified Asbestos Investigator's Signature Date Certificate Number Expiration Date

Tel. # (917) 376-4192 Fax # _____

Email lultee@yahoo.com

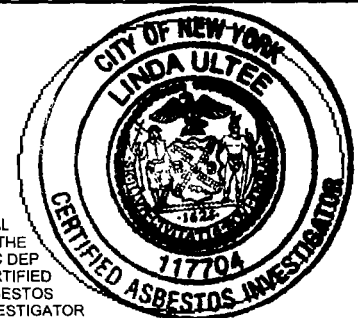

SEAL
OF THE
NYC DEP
CERTIFIED
ASBESTOS
INVESTIGATOR

The investigator shall assume that some or all of the areas investigated contain ACM, and for each area that is not assumed to contain ACM, collect and submit for analysis bulk samples in accordance with §§ 1-36, 1-37, and 1-44 of the DEP Asbestos Rules and EPA publications 560/5-85-024 and 560/5-85-030a and 40 CFR 763.86.

Is it a Build-It-Back project? ☐ Yes, App ID # _____ ☒ No



25653163